

Local Weak Observability Conditions of Sensorless AC Drives

Mohamad Koteich, *Student Member, IEEE*,
Abdelmalek Maloum, Gilles Duc and Guillaume Sandou

KEYWORDS

Sensorless control, Synchronous motor, Induction Motor, AC machine.

ABSTRACT

Alternating current (AC) electrical drive control without mechanical sensors is an active research topic. This paper studies the observability of both induction machine and synchronous machine sensorless drives. Observer-based sensorless techniques are known for their deteriorated performance in some operating conditions. An observability analysis of the machines helps understanding (and improving) the observer's behavior in the aforementioned conditions.

I. INTRODUCTION

Eco-friendly technologies have attracted worldwide attention due to several environmental issues. In this context, electric motors have become a serious competitor with combustion engines in many industrial applications, especially in automotive industry.

The use of AC drives has been pioneered by the recent advances in power semiconductor switching frequencies, and power converter topologies [1]. High performance control of AC

Mohamad Koteich is with Renault S.A.S. Technocentre, 78288 Guyancourt, France, and also with L2S - CentraleSupélec - CNRS - Paris-Sud University, 91192 Gif-sur-Yvette, France (e-mail: mohamad.koteich@renault.com).

Abdelmalek Maloum is with Renault S.A.S. Technocentre, 78288 Guyancourt, France (e-mail: abdelmalek.maloum@renault.com).

Gilles Duc and Guillaume Sandou are with L2S - CentraleSupélec - CNRS - Paris-Sud University, 91192 Gif-sur-Yvette, France (e-mail: gilles.duc@centralesupelec.fr; guillaume.sandou@centralesupelec.fr).

drives can be achieved using vector control [2], which requires the measurement of the rotor position. For many reasons, mainly for cost reduction and reliability increase, mechanical sensorless techniques have attracted the attention of researchers as well as many large manufacturers [3]. These techniques consist of sensing the motor currents and voltages, and using them as inputs to an estimation algorithm (such as the state-observer algorithm) that estimates the rotor angular speed and/or position.

One limitation of the use of sensorless techniques is the deteriorated performance in some operating conditions: namely the low-speed operation in the case of synchronous machines (SMs), and the low-frequency input voltage in the case of induction machines (IMs) [4]. Usually, this problem is viewed as a stability problem, and sometimes is treated based on experimental results. However, the real problem lies in the so-called “observability conditions” of the system.

Over the past few years, a promising approach, based on the local weak observability concept [5], has been used in order to better understand the deteriorated performance of sensorless AC drives. Several papers have been published on this topic: authors in [6] [7] [8] [9] [10] study the local observability of IMs in some operating conditions, namely for zero acceleration and low-frequency input voltages. Among SMs, only the permanent magnet synchronous machine (PMSM) is studied in the literature [9] [10] [11] [12] [13].

A unified approach of AC drives observability analysis is proposed in this paper. Sufficient conditions for both IM and SM’s observability are studied. Concerning the IM, a more general study, that covers a wider region of operating conditions, is done; the speed is not considered to be constant, which requires the estimation of the resistant torque. Concerning the SMs, the wound-rotor synchronous machine (WRSM) is studied, and considered to be the general case of SMs; its model and observability conditions are easily extended to the permanent magnet synchronous machine (PMSM) and the synchronous reluctance machine (SyRM).

The main purpose of this paper is to contribute to a better understanding of the deteriorated performance of sensorless techniques. The paper is divided into five sections; after this introduction, the local weak observability concept is presented in section 2. Sections 3 and 4 are dedicated to the observability study of IMs and SMs respectively. Conclusions are made in section 5.

II. LOCAL WEAK OBSERVABILITY THEORY

The *local weak observability* concept [5], based on the rank criterion, is introduced in this section.

A. Problem statement

Systems of the following form (denoted Σ) are considered:

$$\Sigma : \begin{cases} \dot{x} = f(x(t), u(t)) \\ y = h(x(t)) \end{cases} \quad (1)$$

where $x \in X \subset \mathbb{R}^n$ is the state vector, $u \in U \subset \mathbb{R}^m$ is the control vector (input), $y \in \mathbb{R}^p$ is the output vector, f and h are C^∞ functions.

The observation problem can be then formulated as follows [14]: *Given a system described by a representation (1), find an accurate estimate $\hat{x}(t)$ for $x(t)$ from the knowledge of $u(\tau)$, $y(\tau)$ for $0 \leq \tau \leq t$.*

The system observability is required for observer design. For nonlinear systems, *global* observability is not practical, since the observer often requires the system to be *instantaneously* observable in a certain *neighborhood* of the state trajectories; the system should be *locally weakly observable*.

B. Observability rank condition

The system Σ is said to satisfy the observability rank condition at x_0 , if the observability matrix, denoted by $\mathcal{O}_y(x)$, is full rank at x_0 . $\mathcal{O}_y(x)$ is given by:

$$\mathcal{O}_y(x) = \frac{\partial}{\partial x} \begin{bmatrix} \mathcal{L}_f^0 h(x) & \mathcal{L}_f h(x) & \mathcal{L}_f^2 h(x) & \dots & \mathcal{L}_f^{n-1} h(x) \end{bmatrix}_{x=x_0}^T \quad (2)$$

where $\mathcal{L}_f^k h(x)$ is the k th-order *Lie derivative* of the function h with respect to the vector field f .

C. Observability theorem

A system Σ (1) satisfying the observability rank condition at x_0 is locally weakly observable at x_0 . More generally, a system Σ (1) satisfying the observability rank condition for any x_0 , is locally weakly observable [5]. Rank criterion gives only a sufficient condition for local weak observability.

III. OBSERVABILITY ANALYSIS OF INDUCTION MACHINES

This section deals with the local observability conditions of induction machines. First, the machine model is presented, then its local weak observability is studied. In this study, the speed is not considered to be constant, therefore the resistant torque, which is assumed to vary slowly, should be added to the estimated state vector.

A. Machine model

The IM can be modeled as a three-phase stator and a three-phase rotor. The stator is supplied by a three-phase source, whereas the rotor windings are in short-circuit (see Figure 1). The IM state-space model in the two-phase stator reference frame (α_s/β_s) can be written as follows:

$$\frac{d\mathcal{I}_s}{dt} = \frac{1}{\sigma L_s} \left[\mathcal{V}_s - r_s \mathcal{I}_s + \frac{M}{L_r} \left(\frac{1}{\tau_r} \mathbb{I}_2 - \omega_e \mathbb{J}_2 \right) \Psi_r \right] \quad (3a)$$

$$\frac{d\Psi_r}{dt} = - \left(\frac{1}{\tau_r} \mathbb{I}_2 - \omega_e \mathbb{J}_2 \right) \Psi_r + \frac{M}{\tau_r} \mathcal{I}_s \quad (3b)$$

$$\frac{d\omega_e}{dt} = \frac{3p^2 M}{2J L_r} \mathcal{I}_s^T \mathbb{J}_2 \Psi_r - \frac{p}{J} T_r \quad (3c)$$

$$\frac{dT_r}{dt} = 0 \quad (3d)$$

where

$$r_s = R_s + R_r \frac{M^2}{L_r^2} \quad ; \quad \sigma = 1 - \frac{M^2}{L_s L_r} \quad ; \quad \tau_r = \frac{L_r}{R_r} \quad (4)$$

R , L and M stand respectively for the resistance, inductance and mutual inductance. The indices s and r stand for stator and rotor parameters. p is the number of pole pairs, J is the inertia of the rotor with the associated load, ω_e is the electrical speed of the rotor and T_r is the resistant torque. \mathcal{I}_s , Ψ_r and \mathcal{V}_s stand for the stator currents, rotor fluxes and stator voltages in the stator reference frame (α_s/β_s) :

$$\mathcal{I}_s = \begin{bmatrix} i_{s\alpha_s} & i_{s\beta_s} \end{bmatrix}^T \quad ; \quad \Psi_r = \begin{bmatrix} \psi_{r\alpha_s} & \psi_{r\beta_s} \end{bmatrix}^T \quad ; \quad \mathcal{V}_s = \begin{bmatrix} v_{s\alpha_s} & v_{s\beta_s} \end{bmatrix}^T \quad (5)$$

The model (3) can be fitted to the structure Σ (1) by taking:

$$x = \begin{bmatrix} \mathcal{I}_s^T & \Psi_r^T & \omega_e & T_r \end{bmatrix}^T \quad ; \quad u = \mathcal{V}_s \quad ; \quad y = \mathcal{I}_s \quad (6)$$

\mathbb{I}_n is the $n \times n$ identity matrix, and \mathbb{J}_2 is the $\pi/2$ rotation matrix :

$$\mathbb{I}_2 = \begin{bmatrix} 1 & 0 \\ 0 & 1 \end{bmatrix} \quad ; \quad \mathbb{J}_2 = \begin{bmatrix} 0 & -1 \\ 1 & 0 \end{bmatrix} \quad (7)$$

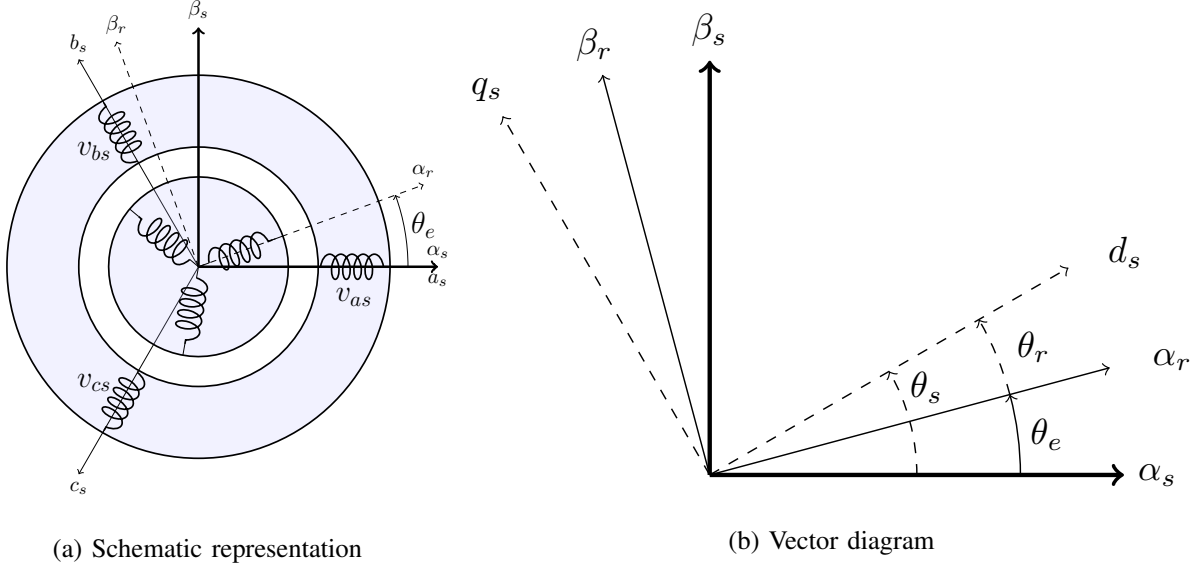


Fig. 1: Schematic representation (a) and vector diagram (b) of the induction machine. $(\alpha_s\beta_s)$, $(\alpha_r\beta_r)$ and (d_sq_s) are respectively the two-phase stator, rotor, and rotating magnetic field reference frames.

B. Observability study

The system (3) is a 6-*th* order system. The local observability study requires the evaluation of derivatives up to the 5-*th* order of the output. However, regarding the equations complexity, only the first and second order derivatives are evaluated for the IM in this paper. Higher order derivatives of the output are too lengthy, and very difficult to deal with. As the observability rank criterion provides sufficient conditions, information contained in the first and second order derivatives is rich enough to study the IM observability. It should be noticed that, in practice, observer-based techniques do not usually need information on higher than second order derivatives.

Symbolic math software is used to evaluate complex expressions. Moreover, the following change of variables is made in order to make the study easier:

$$\tilde{\mathcal{I}}_s = \sigma L_s \mathcal{I}_s \quad (8)$$

$$\tilde{\Psi}_r = \frac{M}{L_r} \Psi_r \quad (9)$$

The system (3) becomes:

$$\frac{d\tilde{\mathcal{I}}_s}{dt} = \mathcal{V}_s + a\tilde{\mathcal{I}}_s + \gamma(t)\tilde{\Psi}_r \quad (10a)$$

$$\frac{d\tilde{\Psi}_r}{dt} = -\gamma(t)\tilde{\Psi}_r - (a-b)\tilde{\mathcal{I}}_s \quad (10b)$$

$$\frac{d\omega_e}{dt} = \frac{c}{J}\tilde{\mathcal{I}}_s^T \mathbb{J}_2 \tilde{\Psi}_r - \frac{p}{J}T_r \quad (10c)$$

$$\frac{dT_r}{dt} = 0 \quad (10d)$$

with

$$a = -\frac{r_s}{\sigma L_s} ; b = -\frac{R_s}{\sigma L_s} ; c = \frac{3p^2}{2\sigma L_s} ; \gamma(t) = \left(\frac{1}{\tau_r} \mathbb{I}_2 - \omega_e \mathbb{J}_2 \right) ; \frac{d\gamma}{dt} = -\frac{d\omega_e}{dt} \mathbb{J}_2 \quad (11)$$

The scaled output is:

$$y = \tilde{\mathcal{I}}_s = \begin{bmatrix} \tilde{i}_{s\alpha_s} \\ \tilde{i}_{s\beta_s} \end{bmatrix} \quad (12)$$

its first order derivative is:

$$\dot{y} = \frac{d\tilde{\mathcal{I}}_s}{dt} = \mathcal{V}_s + a\tilde{\mathcal{I}}_s + \gamma(t)\tilde{\Psi}_r \quad (13)$$

Adding (10a) and (10b) gives:

$$\frac{d\tilde{\mathcal{I}}_s}{dt} + \frac{d\tilde{\Psi}_r}{dt} = \mathcal{V}_s + b\tilde{\mathcal{I}}_s \quad (14)$$

then:

$$\frac{d\tilde{\Psi}_r}{dt} = \mathcal{V}_s + b\tilde{\mathcal{I}}_s - \frac{d\tilde{\mathcal{I}}_s}{dt} \quad (15)$$

The second order derivative of the output can be then written as:

$$\frac{d^2\tilde{\mathcal{I}}_s}{dt^2} = \frac{d\mathcal{V}_s}{dt} + a\frac{d\tilde{\mathcal{I}}_s}{dt} + \gamma(t)\frac{d\tilde{\Psi}_r}{dt} + \frac{d\gamma}{dt}\tilde{\Psi}_r \quad (16)$$

$$= \frac{d\mathcal{V}_s}{dt} + a\frac{d\tilde{\mathcal{I}}_s}{dt} + \gamma(t)\mathcal{V}_s + \gamma(t)b\tilde{\mathcal{I}}_s - \gamma(t)\frac{d\tilde{\mathcal{I}}_s}{dt} + \frac{d\gamma}{dt}\tilde{\Psi}_r \quad (17)$$

$$= \frac{d\mathcal{V}_s}{dt} + \gamma(t)\mathcal{V}_s + (a\mathbb{I}_2 - \gamma(t))\frac{d\tilde{\mathcal{I}}_s}{dt} + \gamma(t)b\tilde{\mathcal{I}}_s + \frac{d\gamma}{dt}\tilde{\Psi}_r \quad (18)$$

The observability study is done using the scaled output and its derivatives:

$$y = \tilde{\mathcal{I}}_s \quad (19)$$

$$\dot{y} = \mathcal{V}_s + a\tilde{\mathcal{I}}_s + \gamma(t)\tilde{\Psi}_r \quad (20)$$

$$\ddot{y} = \frac{d\mathcal{V}_s}{dt} + a\mathcal{V}_s + (a^2\mathbb{I}_2 - (a-b)\gamma(t))\tilde{\mathcal{I}}_s + \left(\frac{d\gamma}{dt} + a\gamma(t) - \gamma(t)^2\right)\tilde{\Psi}_r \quad (21)$$

The IM observability matrix, evaluated for these derivatives, can be written as:

$$\mathcal{O}_y^{IM} = \begin{bmatrix} 1 & 0 & 0 & 0 & 0 & 0 \\ 0 & 1 & 0 & 0 & 0 & 0 \\ a & 0 & \frac{1}{\tau_r} & \omega_e & \tilde{\psi}_{r\beta_s} & 0 \\ 0 & a & -\omega_e & \frac{1}{\tau_r} & -\tilde{\psi}_{r\alpha_s} & 0 \\ d_{11} & d_{12} & e_{11} & e_{12} & f_{11} & f_{12} \\ d_{21} & d_{22} & e_{21} & e_{22} & f_{21} & f_{22} \end{bmatrix} \quad (22)$$

with:

$$d_{11} = a^2 - \frac{a-b}{\tau_r} - \frac{c}{J}\tilde{\psi}_{r\beta_s}^2 \quad ; \quad d_{12} = -(a-b)\omega_e + \frac{c}{J}\tilde{\psi}_{r\alpha_s}\tilde{\psi}_{r\beta_s} \quad (23)$$

$$d_{22} = a^2 - \frac{a-b}{\tau_r} - \frac{c}{J}\tilde{\psi}_{r\alpha_s}^2 \quad ; \quad d_{21} = (a-b)\omega_e + \frac{c}{J}\tilde{\psi}_{r\alpha_s}\tilde{\psi}_{r\beta_s} \quad (24)$$

$$e_{11} = \frac{a}{\tau_r} - \frac{1}{\tau_r^2} + \omega_e^2 + \frac{c}{J}\tilde{i}_{s\beta_s}\tilde{\psi}_{r\beta_s} \quad ; \quad e_{12} = a\omega_e - 2\frac{\omega_e}{\tau_r} + \frac{d\omega_e}{dt} - \frac{c}{J}\tilde{i}_{s\alpha_s}\tilde{\psi}_{r\beta_s} \quad (25)$$

$$e_{22} = \frac{a}{\tau_r} - \frac{1}{\tau_r^2} + \omega_e^2 + \frac{c}{J}\tilde{i}_{s\alpha_s}\tilde{\psi}_{r\alpha_s} \quad ; \quad e_{21} = -a\omega_e + 2\frac{\omega_e}{\tau_r} - \frac{d\omega_e}{dt} - \frac{c}{J}\tilde{i}_{s\beta_s}\tilde{\psi}_{r\alpha_s} \quad (26)$$

$$f_{11} = 2\omega_e\tilde{\psi}_{r\alpha_s} - (a-b)\tilde{i}_{s\beta_s} + \left(a - \frac{2}{\tau_r}\right)\tilde{\psi}_{r\beta_s} \quad ; \quad f_{12} = -\frac{p}{J}\tilde{\psi}_{r\beta_s} \quad (27)$$

$$f_{21} = 2\omega_e\tilde{\psi}_{r\beta_s} + (a-b)\tilde{i}_{s\alpha_s} - \left(a + \frac{2}{\tau_r}\right)\tilde{\psi}_{r\alpha_s} \quad ; \quad f_{22} = \frac{p}{J}\tilde{\psi}_{r\alpha_s} \quad (28)$$

The matrix \mathcal{O}_y^{IM} (22) is a 6×6 matrix, its determinant is the following:

$$\Delta_{IM} = \frac{p}{J} \frac{M^2}{L_r^2} \left[\frac{1}{\tau_r} \frac{d\omega_e}{dt} (\psi_{r\alpha_s}^2 + \psi_{r\beta_s}^2) - \left(\omega_e^2 + \frac{1}{\tau_r^2} \right) \left(\frac{d\psi_{r\alpha_s}}{dt} \psi_{r\beta_s} - \frac{d\psi_{r\beta_s}}{dt} \psi_{r\alpha_s} \right) \right] \quad (29)$$

The expression (29) gives a sufficient local weak observability condition of the system (3); the value of Δ_{IM} has to be non-zero to ensure the local observability of sensorless IM drives.

1) *Results interpretation:* The expression (29) evokes in the following two particular situations (to ensure the local weak observability of the system):

- $\dot{\omega}_e = 0$: For constant rotor speed, the rotor fluxes should be neither constant (or slowly varying) nor linearly dependent, i.e. $\psi_{r\alpha_s} \neq k \cdot \psi_{r\beta_s}$, for all constant k .
- $\dot{\psi}_{r\alpha_s} = \dot{\psi}_{r\beta_s} = 0$: If the rotor fluxes are slowly varying (constant), which usually corresponds to low-frequency input voltages, the speed has to vary (rapidly).

2) *Geometrical interpretation:* The IM is locally weakly observable if the determinant Δ_{IM} (29) is different from zero, this means:

$$\frac{\tau_r \dot{\omega}_e}{1 + \tau_r^2 \omega_e^2} \neq \frac{\frac{d\psi_{r\alpha_s}}{dt} \psi_{r\beta_s} - \frac{d\psi_{r\beta_s}}{dt} \psi_{r\alpha_s}}{\psi_{r\alpha_s}^2 + \psi_{r\beta_s}^2} \iff \frac{d}{dt} \arctan(\tau_r \omega_e) \neq \frac{d}{dt} \arctan\left(\frac{\psi_{r\beta_s}}{\psi_{r\alpha_s}}\right) \quad (30)$$

Knowing that (Figure 1b):

$$\frac{d}{dt} \arctan\left(\frac{\psi_{r\beta_s}}{\psi_{r\alpha_s}}\right) = \frac{d}{dt} \theta_s \quad (31)$$

the condition (30) becomes:

$$\omega_s \neq \frac{d}{dt} \arctan(\tau_r \omega_e) \quad (32)$$

where ω_s is the angular frequency of the rotating magnetic field. The relationship (32) tells that if the rotor speed ω_e is slowly varying, the input voltage frequency should not be very low. Nevertheless, in a wide range of applications, the rotor speed is (almost) constant during the most of machine operation time, the main conclusion to ensure the IM local weak observability is that the input voltage frequency should not be very low.

IV. OBSERVABILITY ANALYSIS OF SYNCHRONOUS MACHINES

An SM is a three-phase machine, having the same stator structure as the IM. Depending on the rotor structure, there exist three main SM sub-families (Figures 2, 3, and 4): wound-rotor (WRSM), permanent-magnet (PMSM) and reluctance type SyRM synchronous machines. Both WRSM and PMSM can be either salient type (non cylindrical) rotor or non-salient type (cylindrical) rotor. Interior PMSM (IPMSM) is a salient machine, surface-mounted PMSM (SPMSM) is a non-salient machine. In this section, WRSM is studied, and considered to be the general case of SMs.

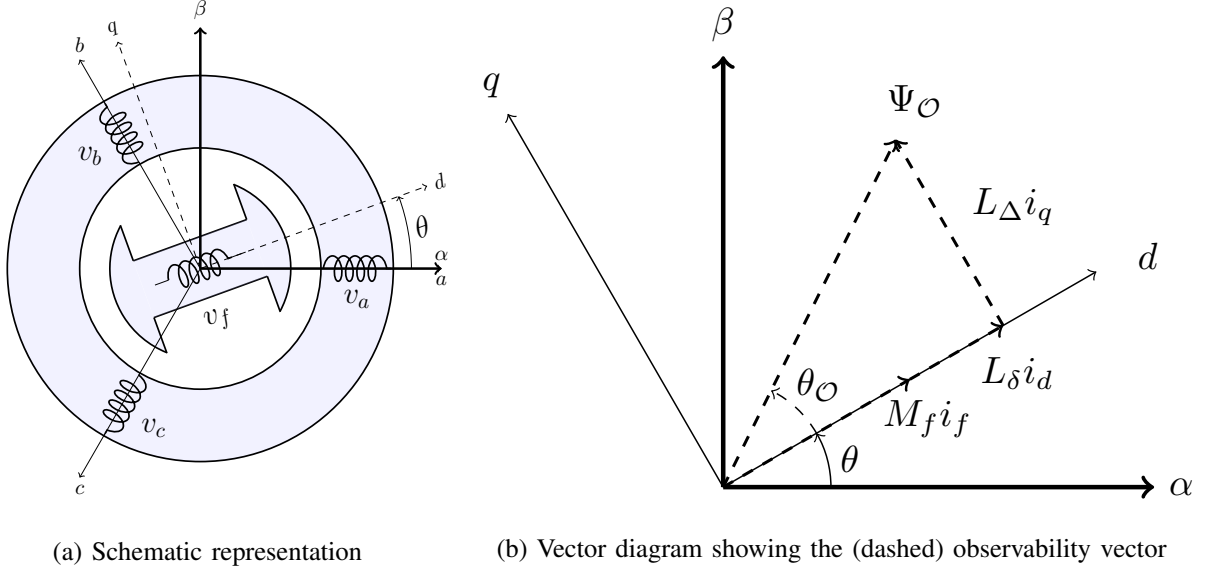


Fig. 2: Schematic representation (a) and vector diagram (b) of the wound-rotor synchronous machine. $(\alpha\beta)$ and (dq) are respectively the stator and rotor reference frames.

A. Wound-rotor synchronous machine model

The state-space model of the WRSM is written in the two-phase $(\alpha\beta)$ stationary reference frame (see Figure 2a), in a way to be fitted to the structure (1):

$$\frac{d\mathcal{I}}{dt} = -\mathfrak{L}^{-1}\mathfrak{R}_{eq}\mathcal{I} + \mathfrak{L}^{-1}\mathcal{V} \quad (33a)$$

$$\frac{d\omega}{dt} = \frac{p}{J}T_m - \frac{p}{J}T_r \quad (33b)$$

$$\frac{d\theta}{dt} = \omega \quad (33c)$$

where the state, input and output vectors are respectively:

$$x = \begin{bmatrix} \mathcal{I}^T & \omega & \theta \end{bmatrix}^T \quad ; \quad u = \mathcal{V} = \begin{bmatrix} v_\alpha & v_\beta & v_f \end{bmatrix}^T \quad ; \quad y = \mathcal{I} = \begin{bmatrix} i_\alpha & i_\beta & i_f \end{bmatrix}^T \quad (34)$$

\mathcal{I} and \mathcal{V} are the current and voltage vectors. Indices α and β stand for stator signals, index f stands for rotor (*field*) ones. ω stands for the electrical rotor angular speed and θ for the electrical angular position of the rotor. \mathfrak{L} is the (position-dependent) matrix of inductances, and \mathfrak{R} is the

matrix of resistances:

$$\mathcal{L} = \begin{bmatrix} L_0 + L_2 \cos 2\theta & L_2 \sin 2\theta & M_f \cos \theta \\ L_2 \sin 2\theta & L_0 - L_2 \cos 2\theta & M_f \sin \theta \\ M_f \cos \theta & M_f \sin \theta & L_f \end{bmatrix} ; \mathfrak{R}_{eq} = \mathfrak{R} + \frac{\partial \mathcal{L}}{\partial \theta} \omega ; \mathfrak{R} = \begin{bmatrix} R_s & 0 & 0 \\ 0 & R_s & 0 \\ 0 & 0 & R_f \end{bmatrix}$$

J is the moment of inertia of the rotor with its associated load, p is the number of pole pairs, T_r is the resistant torque and T_m is the motor torque:

$$T_m = \frac{3}{2} p M_f i_f (i_\beta \cos \theta - i_\alpha \sin \theta) - \frac{3}{2} p L_2 [(i_\alpha^2 - i_\beta^2) \sin 2\theta - 2i_\alpha i_\beta \cos 2\theta] \quad (35)$$

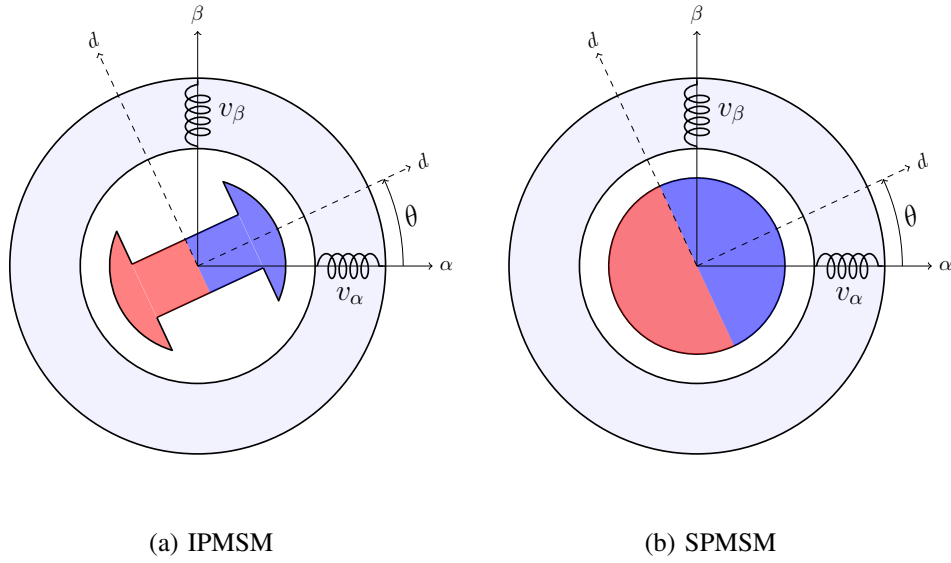


Fig. 3: Schematic representation of the IPMSM (a) and the SPMSM (b)

B. Other SMs models

The other SMs can be seen as special cases of the salient-type WRSB; the IPMSM (Figure 3a) model can be derived by considering the rotor magnetic flux to be constant:

$$\frac{di_f}{dt} = 0 \quad (36)$$

and by substituting $M_f i_f$ by the permanent magnet flux ψ_r :

$$i_f = \frac{\psi_r}{M_f} \quad (37)$$

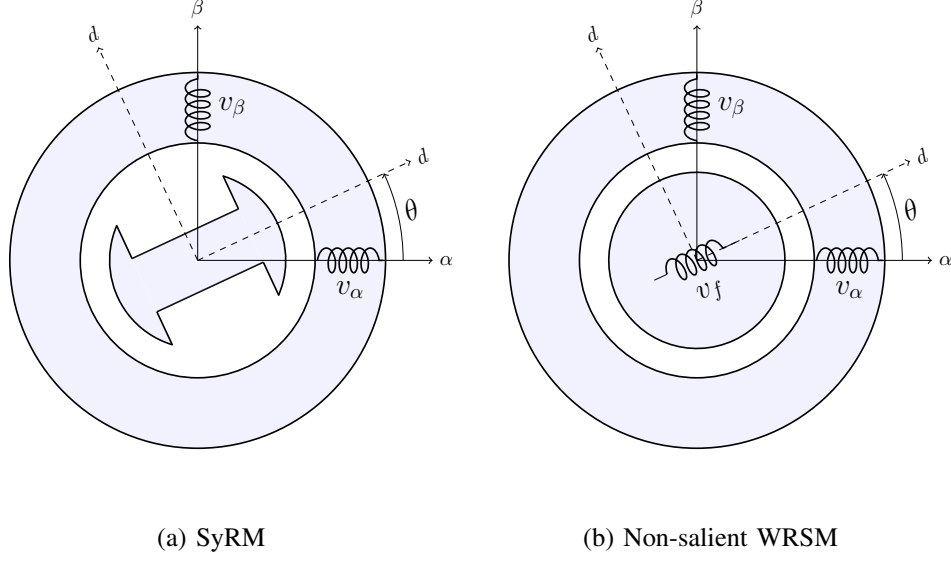


Fig. 4: Schematic representation of the SyRM (a) and the non-salient WRSM (b)

The SyRM (Figure 4a) model can be derived from the IPMSM model by considering the rotor magnetic flux ψ_r to be zero:

$$\psi_r \equiv 0 \quad (38)$$

The equations of the non-salient WRSM (Figure 4b) and SPMSM (Figure 3b) are the same as the salient WRSM and IPMSM respectively, except that the stator self-inductances are constant and independent of the rotor position, that is:

$$L_2 = 0 \quad \implies \quad L_d = L_q = L_0 \quad (39)$$

C. Observability study

The system (33) is a 5-*th* order system. Its observability study requires the evaluation of the output derivatives up to the 4-*th* order. In this study, only the first order derivatives are calculated, higher order ones are very difficult to calculate and to deal with. This gives the following “partial” observability matrix:

$$\mathcal{O}_y^{SM} = \begin{bmatrix} \mathbb{I}_3 & \mathbb{O}_{3 \times 1} & \mathbb{O}_{3 \times 1} \\ -\mathcal{L}^{-1} \mathfrak{R}_{eq} & -\mathcal{L}^{-1} \mathcal{L}' \mathcal{I} & \mathcal{L}^{-1'} \frac{d\mathcal{I}}{dt} - \mathcal{L}^{-1} \mathcal{L}'' \omega \mathcal{I} \end{bmatrix} \quad (40)$$

where $\mathbb{O}_{n \times m}$ is an $n \times m$ zero matrix. \mathfrak{L}' and \mathfrak{L}'' denote, respectively, the first and second partial derivatives of \mathfrak{L} with respect to θ .

It is sufficient to have five linearly independent lines of matrix (40) to insure the local observability of the system. The first five lines, which come from the first derivatives of i_α and i_β , are studied. This choice is motivated by the fact that these currents are available for measurement in all synchronous machines, the rotor current (that gives the sixth line of matrix (40)) does not exist for PMSM and SyRM. Another reason comes from the physics of the machine: i_f is a DC signal, whereas both i_α and i_β are AC signals, so it is more convenient for physical interpretation to take them together.

Symbolic math software is used to calculate the determinant. Currents and fluxes are expressed in the rotor (dq) reference frame (using the Park transformation) in order to make the interpretation easier. The determinant is written, in terms of stator currents and fluxes, under the following general form:

$$\Delta_{SM} = \frac{L_\Delta}{L_D L_q} \left[\left(\frac{1}{L_\Delta} (\psi_d - L_q i_d)^2 + L_\delta i_q^2 \right) \omega + \frac{d\psi_d}{dt} i_q + \frac{d\psi_q}{dt} i_d - \left(\frac{di_d}{dt} \psi_q + \frac{di_q}{dt} \psi_d \right) \right] \quad (41)$$

with

$$L_D = L_d - \frac{M_f^2}{L_f} ; L_\Delta = L_\delta - \frac{M_f^2}{L_f} ; L_d = L_0 + L_2 ; ; L_q = L_0 - L_2 ; ; L_\delta = L_d - L_q \quad (42)$$

The observability conditions for the different SMs can be deduced from (41), by replacing the fluxes by their expressions in the rotor (dq) reference frame as the following:

$$a) \text{ WRSM: } \psi_d = L_d i_d + M_f i_f ; \quad \psi_q = L_q i_q$$

$$\begin{aligned} \Delta_{WRSM} &= \frac{1}{L_D L_q} [(L_\delta i_d + M_f i_f)^2 + L_\Delta L_\delta i_q^2] \omega \\ &+ \frac{L_\Delta}{L_D L_q} \left[\left(L_\delta \frac{di_d}{dt} + M_f \frac{di_f}{dt} \right) i_q - (L_\delta i_d + M_f i_f) \frac{di_q}{dt} \right] \end{aligned} \quad (43)$$

The determinant of the non-salient rotor WRSM ($L_\delta = 0$) can be then deduced:

$$\Delta_{N-WRSM} = \frac{M_f^2}{L_D L_q} \left[i_f^2 \omega - \frac{M_f}{L_f} \left(i_q \frac{di_f}{dt} - i_f \frac{di_q}{dt} \right) \right] \quad (44)$$

$$b) \text{ PMSM: } \psi_d = L_d i_d + \psi_r ; \quad \psi_q = L_q i_q ; \quad L_D = L_d ; \quad L_\Delta = L_\delta$$

$$\Delta_{IPMSM} = \frac{1}{L_d L_q} [(L_\delta i_d + \psi_r)^2 + L_\delta^2 i_q^2] \omega + \frac{L_\delta}{L_d L_q} \left[L_\delta \frac{di_d}{dt} i_q - (L_\delta i_d + \psi_r) \frac{di_q}{dt} \right] \quad (45)$$

$$\Delta_{SPMSM} = \frac{\psi_r^2}{L_0^2} \omega \quad (46)$$

c) *SyRM*: $\psi_d = L_d i_d$; $\psi_q = L_q i_q$; $L_D = L_d$; $L_\Delta = L_\delta$

$$\Delta_{SyRM} = \frac{L_\delta^2}{L_d L_q} \left[(i_d^2 + i_q^2) \omega + \frac{di_d}{dt} i_q - i_d \frac{di_q}{dt} \right] \quad (47)$$

1) *Results interpretation*: The expression of Δ_{WRSM} (43) shows that WRSM can be observable at standstill if the currents i_d , i_q and i_f are not constant at the same time. Non-salient WRSM (44), IPMSM (45) and SyRM (47) can be also observable at standstill. However, the observability of SPMSM at standstill cannot be guaranteed.

2) *Geometrical interpretation*: The observability condition $\Delta_{WRSM} \neq 0$ implies:

$$\omega \neq \frac{(L_\delta i_d + M_f i_f) L_\Delta \frac{di_q}{dt} - \left(L_\delta \frac{di_d}{dt} + M_f \frac{di_f}{dt} \right) L_\Delta i_q}{(L_\delta i_d + M_f i_f)^2 + L_\Delta L_\delta i_q^2} \quad (48)$$

The above equation can be written as:

$$\omega \neq \frac{(L_\delta i_d + M_f i_f)^2 + L_\Delta^2 i_q^2}{(L_\delta i_d + M_f i_f)^2 + L_\Delta L_\delta i_q^2} \frac{(L_\delta i_d + M_f i_f) L_\Delta \frac{di_q}{dt} - \left(L_\delta \frac{di_d}{dt} + M_f \frac{di_f}{dt} \right) L_\Delta i_q}{(L_\delta i_d + M_f i_f)^2 + L_\Delta^2 i_q^2}$$

then

$$\omega \neq \frac{(L_\delta i_d + M_f i_f)^2 + L_\Delta^2 i_q^2}{(L_\delta i_d + M_f i_f)^2 + L_\Delta L_\delta i_q^2} \frac{d}{dt} \arctan \left(\frac{L_\Delta i_q}{L_\delta i_d + M_f i_f} \right) \quad (49)$$

The following approximation can be adopted¹:

$$\frac{(L_\delta i_d + M_f i_f)^2 + L_\Delta^2 i_q^2}{(L_\delta i_d + M_f i_f)^2 + L_\Delta L_\delta i_q^2} \approx 1 \quad (50)$$

Thus, the WRSM observability condition can be formulated as:

$$\omega \neq \frac{d}{dt} \arctan \left(\frac{L_\Delta i_q}{L_\delta i_d + M_f i_f} \right) \quad (51)$$

It can be seen that the above equation describes a vector, which will be called the *observability vector* and denoted $\Psi_{\mathcal{O}}$ (Figure 2b), that has the following components in the dq reference frame:

$$\Psi_{\mathcal{O}d} = L_\delta i_d + M_f i_f \quad (52)$$

$$\Psi_{\mathcal{O}q} = L_\Delta i_q \quad (53)$$

The condition (51) becomes:

$$\omega \neq \frac{d}{dt} \theta_{\mathcal{O}} \quad (54)$$

¹This approximation does not affect the observability conditions at standstill where $\omega = 0$ and currents are non-zero. In addition, this assumption is an equality for the PMSM and the SyRM.

where θ_O is the phase of the vector Ψ_O in the dq reference frame.

Finally, the following SMs local weak observability condition can be stated: the observability of an SM is guaranteed if the rotational velocity of the observability vector with respect to the rotor is different from the electrical velocity of the rotor with respect to the stator. Therefore, at standstill, the observability vector should rotate and not be fixed.

V. CONCLUSIONS

The local weak observability of motion-sensorless three-phase electrical drives has been studied through this paper. The study shows that the observability might not be guaranteed in some operating conditions: such as low-frequency rotor fluxes for the induction machines, and standstill operation for the synchronous machines.

The main conclusion, concerning the local weak observability of induction machines, is that input voltage frequency should not be low to ensure the machine observability.

The concept of *observability vector* generalizes the observability conditions for synchronous machines: this vector should rotate with respect to the rotor with a speed different from the electrical speed of the rotor with respect to the stator, to ensure the observability.

Having the expressions (29), (43), (44), (45) and (47), it seems to be interesting to combine high-frequency signal injection techniques with observer-based sensorless techniques. In other words, high-frequency voltages can be injected in the stator (or the rotor in the case of WRSM) windings, in order to guarantee the machine observability in the critical operating conditions, which improves the observer's behaviour. Concerning the SPMSM, the only way to insure its observability is to move the rotor (equation (46)), to make the speed different from zero.

REFERENCES

- [1] Bose, Bimal K. "Power electronics and motor drives: advances and trends." Academic press, 2010.
- [2] Leonhard, W. , "Control of Electrical Drives", 3rd ed. Berlin, Germany, Springer-Verlag, 2001.
- [3] Vas, P. "Sensorless Vector and Direct Torque Control". Monographs in electrical and electronic engineering, Oxford University Press, 1998.
- [4] Holtz, J., "Sensorless control of induction motor drives," Proceedings of the IEEE , vol.90, no.8, pp.1359,1394, Aug 2002
- [5] Hermann, R.; Krener, Arthur J., "Nonlinear controllability and observability," Automatic Control, IEEE Transactions on, vol.22, no.5, pp.728,740, Oct 1977.

- [6] De Wit, C.C.; Youssef, A.; Barbot, J.-P.; Martin, P.; Malrait, F., "Observability conditions of induction motors at low frequencies," *Decision and Control*, 2000. Proceedings of the 39th IEEE Conference on, vol.3, no., pp.2044,2049 vol.3, 2000.
- [7] Ghanes, M.; De Leon, J.; Glumineau, A., "Observability Study and Observer-Based Interconnected Form for Sensorless Induction Motor," *Decision and Control*, 2006 45th IEEE Conference on, vol., no., pp.1240,1245, 13-15 Dec. 2006.
- [8] Marino, Riccardo, Patrizio Tomei, and Cristiano M. Verrelli. "Induction motor control design." Springer Science & Business Media, 2010.
- [9] Vaclavek, P.; Blaha, P.; Herman, I., "AC Drive Observability Analysis," *Industrial Electronics, IEEE Transactions on*, vol.60, no.8, pp.3047,3059, Aug. 2013.
- [10] Glumineau, Alain, and Jesús de León Morales. "Sensorless AC Electric Motor Control: Robust Advanced Design Techniques and Applications", *Advances in Industrial Control*, Springer International Publishing Switzerland, 2015.
- [11] Guchuan Zhu; Kaddouri, A.; Dessaint, L.-A.; Akhrif, O., "A nonlinear state observer for the sensorless control of a permanent-magnet AC machine," *Industrial Electronics, IEEE Transactions on*, vol.48, no.6, pp.1098,1108, Dec 2001.
- [12] Ezzat, M.; de Leon, J.; Gonzalez, N.; Glumineau, A., "Observer-controller scheme using high order sliding mode techniques for sensorless speed control of permanent magnet synchronous motor," *Decision and Control (CDC)*, 2010 49th IEEE Conference on, vol., no., pp.4012,4017, 15-17 Dec. 2010.
- [13] Zaltini, D.; Ghanes, M.; Barbot, Jean Pierre; Abdelkrim, M.N., "Synchronous motor observability study and an improved zero-speed position estimation design," *Decision and Control (CDC)*, 2010 49th IEEE Conference on, vol., no., pp.5074,5079, 15-17 Dec. 2010.
- [14] Besancon, G., "Nonlinear observers and applications", *Lecture Notes in Control and Information Science* 363, Springer Verlag, 2007.